



Air
Controls
Products

Service Bulletin 406K Retro-Kit



The washer diameter on 7002A is 0.70in. Certain OE wheels have a valve hole counterbore diameter smaller than 0.70in. Retro-fit 7002A with 406K and install nut to 71 in-lbs.


Vehicles that will require 406K:

**2003-2009 Lexus GX470 with 17in alloy wheels
2006-2008 Lexus IS sedan with 17in alloy wheels
2006-2012 Toyota RAV4 with 16in steel wheels**

Directions:

- 1.) Check counterbore diameter. If a US dime coin does not fit, 406K is needed.**
- 2.) Remove the washer and grommet from 7002A and install 406K parts.**

REDI-Sensor™

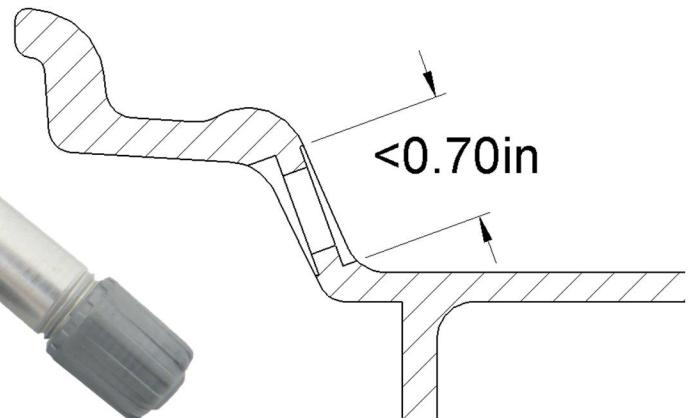

Dill Air Controls Products 1-800-815-DILL (3455)

www.dillvalves.com

DISCLAIMER: The data presented in this document is accurate to the best of our knowledge.